

# Essentials for Healthy Homes Practitioners



## Keep it Dry

### Learning Objectives

- Name three health hazards in the home that are related to excessive moisture.
- Identify four sources of moisture in the home.
- Describe five strategies for controlling moisture in the home.

Excess moisture is associated with increased incidence of respiratory disease. The prevalence of asthma or respiratory symptoms is twice as high for occupants of schools or homes with evidence of dampness problems or molds. In places where there is mold and environmental tobacco smoke there has been a noted 20-40% increase in asthma symptoms or respiratory symptoms.

Molds can trigger asthma attacks in sensitive individuals. They can also adversely affect immune system function.

### IOM Report Mold & Moisture Related Health Effects

- Upper respiratory tract symptoms
- Coughing
- Wheezing
  - Asthma symptoms
- Hypersensitivity pneumonitis

### Moisture Sources

#### A Keep It Dry example – Does Water Drain Away From the House?

Drainage is the key to rainwater control. The roof, the walls, the windows, the foundation and the site must drain water away from the building. Examine the site to see how rainwater flows. Does the landscape drain water away from the house or towards it? Is there evidence the water table at the site is near the surface? Are there gutters on the house?



-  Start with People
-  House as a System
-  Keep It:
  -  1. Dry
  -  2. Clean
  -  3. Pest-Free
  -  4. Ventilated
  -  5. Safe
  -  6. Contaminant-Free
  -  7. Maintained
-  Making it Work

### Learning Objectives for this module

- Name three health hazards in the home that are related to excessive moisture.
- Identify four sources of moisture in the home.
- Describe five strategies for controlling moisture in the home.

# Essentials for Healthy Homes Practitioners



## Moisture Sources

Keep things dry. These are the sources of water that have to be controlled to avoid problems.

- Poorly managed rainwater/groundwater
  - Poor roof, wall, window and foundation drainage
  - Defects in rain barriers
- Plumbing leaks
- Condensation on surface
  - Surfaces chilled by mechanical equipment, earth contact, outdoor air contact
- Construction moisture
  - Concrete, wet spray cellulose, gypsum mud
  - Damp earth in crawlspace



## Prevalence of Interior Water Leakage in the U.S.

- 8.5% had interior water leakage in 12 month period
  - 1.9% from fixtures
  - 3.6% from leaking pipes
  - 0.8% from broken water heater
  - 2.4% from other or unknown causes
- The problem was worse for:
  - Renters – 11.2%
  - Those living below the poverty line – 11.0%
- Up from 8.1% in 2009

*From American Housing Survey – 2011<sup>a</sup>*

8.5 % Interior Water Leak	
Source of interior leak	% among total # of units
Leaking pipes	3.6%
Fixtures	1.9%
Broken water heater	0.8%
Other or unknown	2.4%

## Prevalence of Exterior Water Leakage in the U.S.

- 11% had exterior water leakage in 12-month period
  - 5.7% from the roof
  - 2.8% from the basement
  - 2.2% from the walls, closed windows or doors
  - 1.2% from other or unknown source
- The problem was worse for:
  - Northeast – 16.7%
  - Midwest – 13.1%

*From American Housing Survey – 2011<sup>a</sup>*

11% Exterior Water Leak	
Source of exterior leak	% among total # of units
Roof	5.7%
Basement	2.8%
Walls/windows/doors	2.2%
Other/unknown	1.2%

<sup>a</sup> Figures will not sum to total because a unit can have more than one type of leak.

# Essentials for Healthy Homes Practitioners




## Construction Factors

Of single family homes excluding mobile homes:

- 43.3% have full or partial basement
- 22.1% have crawlspace
- 33.1% have slab
- 1.6% have "other"

*From American Housing Survey – 2011<sup>a</sup>*

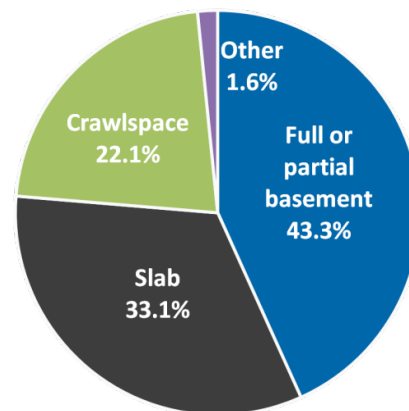

## Exterior physical condition of homes

- 18% of homes have some physical condition contributing to leaks
- 2.0% have sagging roof
- 3.6% have missing roofing material
- 1.5% have hole in roof
- 2.5% are missing bricks siding or other outside wall material
- 1.2% have sloping outside walls
- 1.0% have boarded up windows
- 5.4% have foundation crumbling or has open crack or hole

*From American Housing Survey – 2011<sup>b</sup>*

18% One or More Exterior Problem	
Exterior condition	% among total # of units
Foundation crumbling/crack/hole	5.4%
Broken windows	4.2%
Missing roofing material	3.6%
Missing outside wall material	2.5%
Sagging roof	2.0%
Hole in roof	1.5%
Sloping outside walls	1.2%
Boarded up windows	1.0%

<sup>b</sup> Note that this excludes multi-unit housing and that since conditions are not mutually exclusive (e.g., one can have both broken windows and missing roofing material), the numbers in the table do not sum to 100%.

# Essentials for Healthy Homes Practitioners



## Comfort Levels

The following ranges are the levels at which most humans feel comfortable in indoor environments:

- Air temperatures: 65°F (when active) – 80°F (when bathing)
- Air relative humidity: 30% – 70%
- Air motion: 20 – 40 feet per minute
- Surrounding surface temperatures: within 10 –15°F of room air

Structural building conditions, personal activities, weather conditions, and the adequacy of available heating and cooling systems all affect the ability of individuals to maintain their indoor environments in these “comfortable” ranges.

## How Water Enters a Building

### Keep out liquid water

- Trace and repair rain leaks, which occur at places where materials join (e.g. an improper flashing detail at a roof/wall joint, no damp proof course in a parapet wall, skylight or equipment curbs).
- Trace and repair surface water and groundwater leaks, which are usually the result of poor or failed drainage detailing (e.g. no capillary break beneath a slab on grade, poorly designed rain gutters, clogged footing drains, poorly graded site).
- Trace and repair plumbing leaks.



### Manage Water Vapor Migration

#### Outdoor air as a source of water vapor

- During cooling seasons, the outdoor air may be hot and humid. If air conditioning systems are not designed to deal with the latent load, thermal comfort problems and condensation in the supply system may result. If the building or rooms, plenums or cavities are running negative in the cooling season, thermal comfort problems may result or condensation may occur in the walls, ceilings or plenums of the building.

#### Combination of wind, capillary suction and sun driven rain as source of wall moisture

- A masonry wall which receives direct sun will experience a significant daily temperature swing on the outer surface. If the outer surface of the wall has even a small amount of moisture entering by wind or capillary suction, moisture can accumulate to saturation levels in the masonry if there is an interior layer of low-permeability material (e.g., foil-faced or extruded foam board,

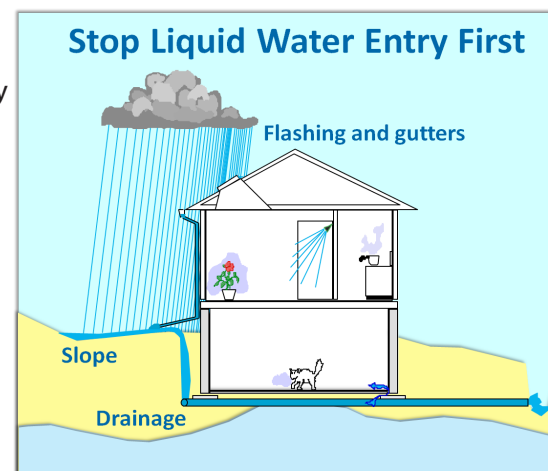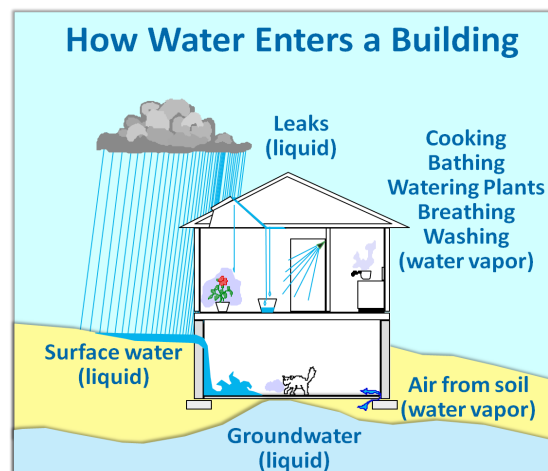


# Essentials for Healthy Homes Practitioners



vinyl wallpaper). The warmed outer surface of the wall creates a large partial pressure difference that drives the moisture into the wall, then the moisture has no place to go.

## Protect indoor chilled surfaces

- Protect surfaces such as chilled water lines or earth contact foundation materials using insulation and low permeability materials layered to keep water vapor away from chilled surfaces. Locate the materials so that unconditioned outdoor air will not be drawn across them.

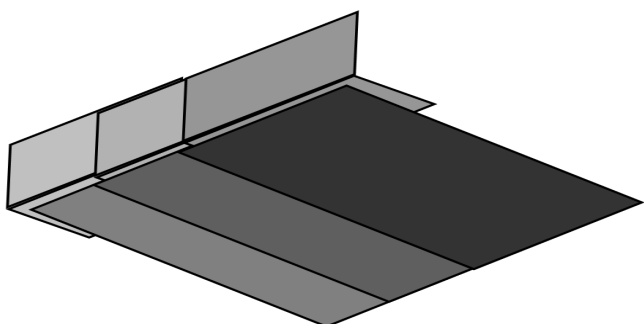

**Step flashing is layered on top of each course of shingles and flashes the joint between an adjoining wall and the roof. Most importantly it does not rely on sealants.**



Copyright 2006, Livable Housing, Inc.  
All rights reserved.

## Problems with Managing Rainwater

Below left is a picture of a downspout that dumps all the collected water next to the foundation. The discharge has been crushed by people or lawnmowers.

On the right is a solution to the problem. This is a picture of a downspout that goes below grade and extends ten feet from the house with solid pipe where it transitions to another fifteen feet of perforated pipe (protected by filter fabric) creating a leaching system.



# Essentials for Healthy Homes Practitioners



## Retrofit rainwater protection

Here is a retrofit method of controlling rainwater from the exterior. EPDM rubber roofing is placed against the foundation wall and extended out below grade. Filter protected drain pipe and porous backfill are used to collect water and drain it away from the foundation.



## Windows Leak?

### Retrofit rainwater protection

Masonry plus rain and sun plus air conditioning plus vinyl wallpaper = mold. You can usually see clues on the outside to shape your indoor inspection. This picture shows severe moisture damage beneath a window. Windows may leak rainwater at mitered corners and where multiple windows are mulled together. They may leak around the edges where they should be flashed into the wall system. The picture below shows the use of a moisture meter to check moisture beneath a window. Contractors and renovators should use window installation methods that prevent such damage.



# Essentials for Healthy Homes Practitioners



Sidings that absorb rainwater in combination with air conditioning and an interior vapor barrier can result in condensation and mold growth. The brick absorbs rainwater, the sun heats the water, evaporating it and creating very high vapor pressure in and behind the brick. The vapor pressure drives water vapor into the wall. The vapor passes through the wall until it hits an intentional (polyethylene films) or accidental (vinyl wallpaper, chalkboard, mirror) vapor barrier that is chilled by the air conditioned interior. Then the vapor condenses.



Back venting the brick, using a low perm sheathing and running the building under positive pressure help reduce this problem. Running the building under negative pressure aggravates the problem.

*Air conditioner condensate drains into building*

## Porous material can wick water from outside



The bottom few inches of this wall are damp because water is wicking up through the footing by “capillary suction.” It is only wet a few inches from the slab because the moisture evaporates into the basement. In an unfinished basement this is probably not a problem, but if the wall is finished using paper covered gypsum board, paneling and wooden studs or furring strips, a dark, damp place is created. This provides good conditions for mold growth.

# Essentials for Healthy Homes Practitioners



**This room smells musty.**

**What do you think is going on?**

**Do you see any visual clues?**



# Essentials for Healthy Homes Practitioners



## Hidden mold?

The picture in the upper left corner shows the picture on the previous page. Notice that the room was a finished room with walls that are partially below grade. The room had no visible mold but smelled musty. Removing the furnishings and finishes revealed significant mold growth.



Molds are organisms that colonize surfaces. They produce large numbers of spores that contain DNA and enough food to start growth. Unless extremely diligent efforts are made to keep surfaces clean on a daily basis, there are mold spores on virtually every surface in a building. Ordinary house dust contains tens of thousands of mold spores per gram.

If conditions are right the spore germinates and sends out thread-like hyphae. The hyphae exude enzymes. If there is enough free water available the enzymes go into the solution and digest available food. The nutrient solution is absorbed back into the hyphae, more growth occurs, and spores are produced until the colony runs out of food or water.

In the photo on the right, the wooden flooring seen here is composed of heartwood Douglas fir and sapwood Spruce. The Douglas fir has almost no mold growth on it because there are very few sugars and starches in heartwood. Molds cannot actually digest cellulose and lignin. The sapwood is covered with mold because it is filled with sugars and starches.



# Essentials for Healthy Homes Practitioners



Moisture meters are useful in determining whether a material is wet or not and tracing the source of problem water.

Crawlspaces may contain mold, pests, pesticides, asbestos, lead paint and sewer gas and be a conduit for radon. An apparently dry crawlspace can add excessive water vapor to a house.

Crawlspaces are often the source of indoor air contaminants. In many areas the most common problems are the result of moisture. Poorly managed rainwater and warm, humid outdoor air are the two most common sources of moisture in crawlspaces. During times when the outdoor dew point is higher than the temperature of surfaces in the crawlspace, the ventilating outdoor air actually humidifies the crawlspace. In mixed/humid and hot humid climates ventilated crawlspaces are problematic. During cold weather, ventilated crawlspaces containing plumbing run the risk of pipes freezing.



## Bad Crawlspace



**Crawl spaces may contain mold, pests, pesticides, asbestos, lead paint, and sewer gas. An apparently dry crawlspace can add excessive water vapor to a house**

Air from crawlspaces is drawn into the occupied portion of houses by the stack effect during cold weather. When an air handler is running, air can be drawn into the occupied portion of the house. This happens when closed doors separate supply air diffusers from return grilles or when there are leaks on return portions of an air distribution system that are located in the crawlspace.

A study conducted by the EPA in crawlspace houses in Tennessee found that the leakage between the crawlspace and the upper portion of the house averaged 38 square inches for houses without ductwork in the crawlspace and 74 square inches for houses with ductwork in the crawlspace.



## *Good sealed crawlspace*



Here is an example of a sealed, insulated crawlspace with good drainage and a vapor barrier covering the soil floor.

## **Failed Drainage Systems**




# Essentials for Healthy Homes Practitioners



Sometimes there are drainage systems installed, but they have failed. Drain lines must be protected from clogging with silt. Traditionally they were covered with layers of straw or felt paper. In the last thirty years, synthetic filter fabrics have been developed that last longer and provide better filtration. In the photos on the previous page the sump pump on the left has broken and has not been repaired. The pump on the right would run except the float that turns on the pump is stuck on the plywood cover.

The picture on the right also shows an example of how sometimes our efforts to make things “better” actually create more problems. The plywood cover was put into place to prevent injury to children and pets, but the design was faulty because it prevented the float from working properly. Therefore possible basement flooding could result.

Ductwork beneath the slab is a problem area. Supply or return ducts are sometimes placed beneath the on-grade slab. This is often the lowest point in the building, so the ducts collect any accidental water from plumbing leaks or rainwater leaks. They are not water tight, so water leaks in from outside. If the soil air has high radon levels then they also provide a good transport pathway. When these cause problems it is often best to abandon them and install new heating or cooling distribution systems.

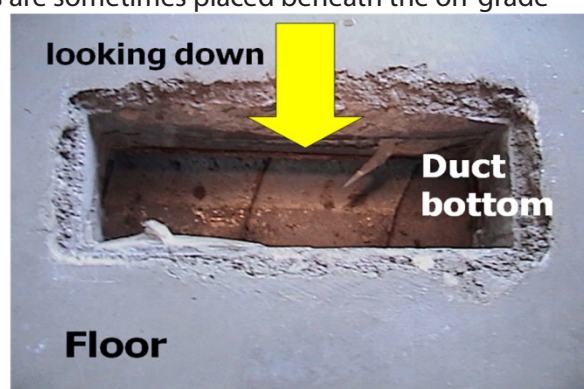

## Are there floor drains? A dehumidifier?

A floor drain in the basement is a good idea. It gives water from a big plumbing or rainwater leak a place to go. Notice the dehumidifier. Below grade spaces often can benefit from a dehumidifier.



## Steps to Dry Basements

- Drain, drain, drain
- No paper or wooden materials in contact with foundation
- Keep warm, humid air away from earth-chilled surfaces.
- Dehumidify



## Plumbing Problems



The next category of problem water is plumbing leaks. When plumbing leaks occur, it is best if they are easy to see, easy to repair and do not wet materials that facilitate mold growth or dry slowly. Wet rooms, such as kitchens, baths and laundry rooms, are the places most likely to have plumbing leaks. Always inspect around toilets, tubs, showers, beneath sinks, clothes washers and dishwashers.

The drain basket and drain trap are vulnerable locations for leaks and vermin entry. Fortunately, they are easily inspected. Put a stopper in the sink and run water to see if the basket leaks. Let the water out to check the trap. Repair by tightening and sealing as needed.

Drain pans are inexpensive ways to reduce the impact of a mechanical leak. They can be used for hot water tanks and for washing machines. Drain pans are not intended to hold the capacity of the appliance. In the picture on the next page, the drain pan actually has a leak (see red circle) and should be replaced. Residents need to know to check the drain pan for water. Indicators such as alarms or lights are helpful for appliances that are not easily accessible (e.g. water heater in the attic).

# Essentials for Healthy Homes Practitioners



The condensation pan beneath a refrigerator may overflow and cause mold growth. Often these pans are heated to evaporate condensate. The heating may have failed. Many people do not realize they should be checked and cleaned periodically.



# Essentials for Healthy Homes Practitioners



If humidity levels are greater than 95% for three to six weeks . . . the result could be the picture below - a vacuum bag with mold. This vacuum was left in a house that was closed up for 6 weeks without air conditioning. The dust on the vacuum cleaner bag served as a food source while the humidity provided the moisture. Mold spores are ubiquitous but don't usually cause a problem unless you have this type of extended high humidity levels.

Chronically high humidity can result in mold growth. While it is true that mold spores generally need a small amount of liquid water to germinate and hyphae tips certainly need liquid water to exude enzymes and absorb digested nutrient, it does not take a lot of liquid moisture. At 90% relative humidity an ordinary surface only needs to be 6 degrees Fahrenheit cooler than the air to be at dew point. In a building, it is likely that there are surfaces few degrees cooler than house air.

## Mold or Mildew?


A frequently asked question is

### *What is the difference between mold and mildew?*

According to wisegeek.com, "in common usage, the difference between mold and mildew usually is in their appearance and the surfaces on which they are growing. Mold is often thicker and black, green, red or blue in color, and mildew usually is lighter, powdery and gray or white. Both mold and mildew often grow in moist and warm locations, but mildew is more often found in showers, on paper and on fabrics, and mold is often found on foods and in walls and other permanent structures."

This chart shows sources of humidity for a family of four. For offices and classrooms, the major source of indoor humidity during warm, humid weather is outdoor air. However, as this chart illustrates, for a residence the dominating source could be a damp foundation. If the foundation is dry, the major sources of indoor humidity are respiration, bathing, cooking and outdoor air.

Also, do not overlook the possibility that occupants have introduced a strong humidity source such as multiple aquariums; a constantly boiling stewpot with no ventilation; a humidifier; or an indoor spa.

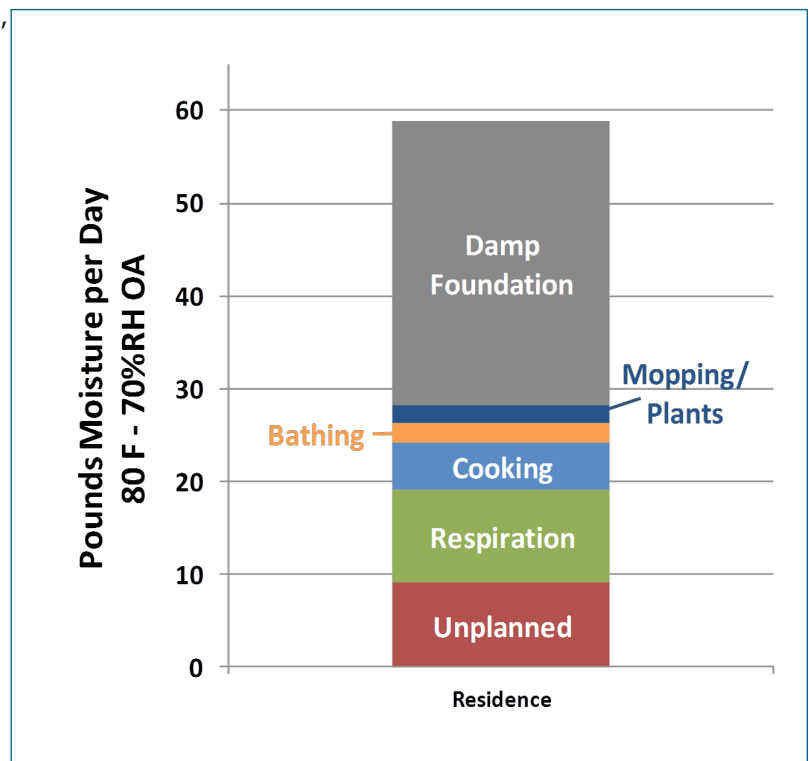


# Essentials for Healthy Homes Practitioners



The picture to the right shows condensation and mold growth on the bottom of a toilet tank. Condensation occurs when there is too much humidity and the surfaces are too cool. The tank is cooled by incoming cold water. The water vapor is from outdoor air during warm humid times of the year and from hot showers. The mold gets nutrient, not from the porcelain, but from paper dust released by tearing toilet tissue.

The problem can be avoided by:

- using an insulated toilet
- air conditioning or dehumidifying the house air
- using a mixing valve to supply warm water to the toilet tank.

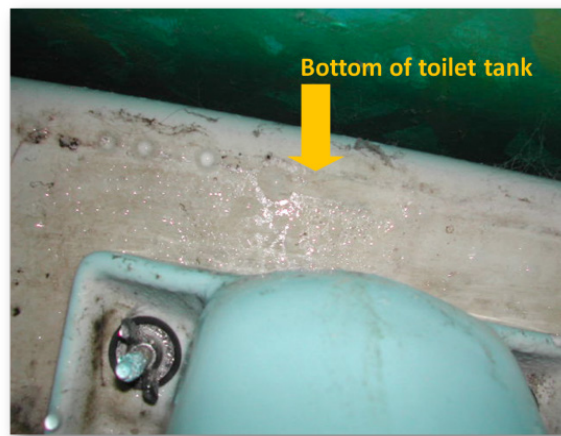

*Mold can grow where we cannot see it*

## Mold in the air conditioner?



Air conditioners have cold surfaces such as the cooling coil, the drain pan, the ductwork down stream of the cooling coil and supply diffusers. Mold can grow in all of these locations. Again, there are two parts to fixing the problem. The first is to clean up the mold and the second is to fix the water issue. Cleaning up the mold should be done following guidance from the U.S. Environmental Protection Agency.

Many residential air conditioners do not have access panels that allow inspection or cleaning of the cooling coils. These should be installed so the coils can be inspected and cleaned. It helps to use higher efficiency filters so there is less dust on the coil.



# Essentials for Healthy Homes Practitioners



The pictures below show mold growing on a ceiling that is being chilled by wind blowing through the soffit across un-insulated gypsum board and mold growing around a window where there is poor insulation.



**Mold due to poor insulation or wind blowing through insulation.**

**Mold around window where there is no insulation.**



This picture shows a cold water line (seen running up the wall in the background), which condenses water above the ceiling. The water drips down onto the gypsum board ceiling resulting in a straight line of mold growth. All things being equal, mold does not grow in straight lines unless it is fed by a straight line water source.



# Essentials for Healthy Homes Practitioners



*Unsealable recessed light allows warm, moist air into the unheated attic*



The recessed light in the photo above right is an opening directly into the attic. When the light is on the heat from the bulb causes a thermal draft to move even more air into the attic. This light is located over the shower in a bathroom that does not have an exhaust fan. As a result the warm, humid shower air is exhausted directly into the attic.

## Considerations for Dehumidifiers

Dehumidifiers are very useful for managing humidity levels in buildings. High humidity in buildings is either the result of warm humid outdoor air entering the building or a strong source of indoor humidity. In a previous picture, the source of humidity was water migrating through the foundation and evaporating into the basement during cold weather. In warm weather, it was both the damp foundation and outdoor air.



When running at least 35% of each hour, air conditioners dehumidify. During part-load conditions they do little or no dehumidification. Dehumidifiers can be very useful in combination with air conditioners in hot humid climates with extended part-load conditions. Dehumidifiers, however, do not cool the air. They ordinarily have supply air

temperatures over 90 degrees F.

### Considerations for Dehumidifiers

- Wattage (Energy Star rated)
- Water removal rate
- Noise
- Drainage
- Icing
- Filter

# Essentials for Healthy Homes Practitioners



Characteristics that are desirable in dehumidifiers are:

- Low energy use – some models are Energy Star rated now;
- Quiet operation – many dehumidifiers are too noisy to use in occupied space;
- A direct drain or a condensate pump (otherwise the tank must be emptied several times a day);
- And freeze protection so they can be used in cool spaces like basements or crawlspaces.

## Response to Mold Problems

- IDENTIFY the problem
  - extent of moisture damage and contamination
  - dynamics of moisture sources
  - appropriate containment and worker protection
- DRY the wet areas in the short term
- DESIGN a solution
  - long term intervention in the moisture dynamics
  - fungal clean-up procedures and clearance criteria
- DISCARD or DECONTAMINATE contaminated material
- IMPLEMENT repairs and program changes to prevent future problems
- SEE EPA Guidance

Mold is a contaminant problem and a moisture problem. Both problems must be solved. The solutions are quite different. The mold itself is best removed from the building by cleaning surfaces or by removing contaminated materials. Containment and encapsulation have been used to intervene in exposures. There is no general agreement in the written remediation guidance on the advisability of containment or encapsulation methods.

In the picture to the right, the attic above the bathroom has mold growing on some of the roof sheathing. A moisture meter is used to test the moisture content of roof sheathing in cold weather.

The test locations are only one foot apart and yet the moisture content of the sheathing is very different. The south facing sheathing is drier, because it receives more sun than the north facing sheathing. Notice that the south facing sheathing is free of mold and the north facing sheathing is covered with mold. The source of the moisture is water vapor in the house air. Warm house air is leaking into the attic through cracks and holes in the ceiling. The cold roof sheathing is dehumidifying the warm air from the house. During the day, the water that condensed overnight on the south facing roof is evaporated by the solar heat.



# Essentials for Healthy Homes Practitioners



This is an oil tank in a stone basement foundation with high humidity. On the right hand side of the tank the bluish-green spots are colonies of aspergillus species. The mold may be getting nutrient from a layer of dust.

On the left hand side the tank has been vacuumed using a HEPA vacuum. A large reduction in spore and hyphae have been made by this simple action. The cleaning was done with the upstairs portion of the house under positive pressure (provided by 1200 cfm window fan). A dehumidifier was installed to maintain humidity at 65% or lower.

Here is a picture of mold growing on painted joint compound in a bathroom. The moisture condenses from the air during showers, in spite of a low volume of exhaust air (around 7 cfm) through the grille. The mold did not grow with one person living in the house, but began shortly after another person moved in.



*For areas less than 10 square feet - clean it up.  
Vacuum, then clean.*

Wiping damp surfaces with water and a small amount of detergent collects any remaining fungal particles. The detergent is needed because the spores of some fungi (e.g. aspergillus and penicillium species) are hydrophobic and pushed off the surface into the air if water without a surfactant is used.

# Essentials for Healthy Homes Practitioners



Some experts recommend the use of a pesticide containing borates labeled to kill or prevent mold as a final rinse. Be sure to read the label carefully and follow instructions if you choose this option. Also, check with the state agency regulating the licensing of pesticide applicators. While homeowners are usually permitted to treat their own home, other people may need to be licensed or certified by the state to apply any pesticide.<sup>1</sup>

## For Bigger Jobs, MUST HAVES are:

- Adequate respirator
- Eye protection
- Rubber gloves
- Coveralls

Make sure you remove and bag all of these items before you leave the work area.


As the size of the area needing remediation increases or if demolition is involved, the chance of larger exposures increases and more worker protection and containment are advised. Quickly drying things out is an important step, because mold will continue to grow as long as there is moisture and nutrient.



# Essentials for Healthy Homes Practitioners



*This shows fairly simple containment using spring-loaded poles and polyethylene film.*

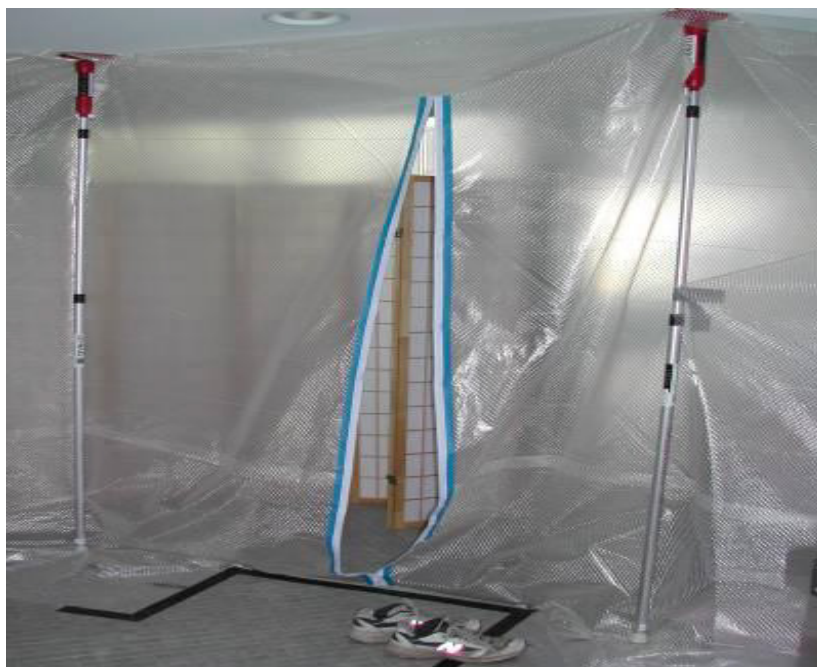

*Containment may be needed for bigger jobs. See EPA Guidance.*

## Code Requirements Related to Moisture

### 302.2 Grading and drainage

- All premises shall be graded and maintained to prevent the erosion of soil and to prevent the accumulation of stagnant water thereon, or within any structure located thereon.

### 304.7 Roofs and drainage

- The roof and flashing shall be sound, tight and not have defects that admit rain.
- Roof drainage shall be adequate to prevent dampness or deterioration in the walls or interior portion of the structure.
- Roof drains, gutters and downspouts shall be maintained in good repair and free from obstructions.
- Roofwater shall

### 304.6 Exterior walls

- All exterior walls shall be free from holes, breaks, and loose or rotting materials; and maintained weatherproof and properly surface coated where required to prevent deterioration.

# Essentials for Healthy Homes Practitioners



## 304.2 Protective treatment

- All exterior surfaces, including but not limited to, doors, door and window frames, cornices, porches, trim, balconies, decks and fences shall be maintained in good condition.
- Exterior wood surfaces, other than decay-resistant woods, shall be protected from the elements and decay by painting or other protective covering or treatment.
- All siding and masonry joints as well as those between the building envelope and the perimeter of windows, doors, and skylights shall be maintained weather resistant and water tight.

## Key Messages

- Excess moisture creates conditions that can affect health.
- Moisture in the home comes from inside and outside.
- Excess moisture in the home should be prevented through appropriate construction methods and plumbing systems, temperature control, ventilation and proper maintenance.

## Learning Objectives

- Name three health hazards in the home that are related to excessive moisture.
- Identify four sources of moisture in the home.
- Describe five strategies for controlling moisture in the home.